

In programming device on M1882, programming error tends to be occurred due to recent shrink device.  
At first, Please check your target device and “device info” <Ctrl+F1> on control software( PG4UW.exe) of M1882.


In case, the following description is expressed,

To avoid this phenomenon, programming error tends to be not occurred by connecting capacitor on socket adapter.

Since suitable location depends on device name. Please follow “Device info” of your target device.


If you change device name after connected capacitor on socket adapter, please check ”Device info” of software again.

Example: “Device info”

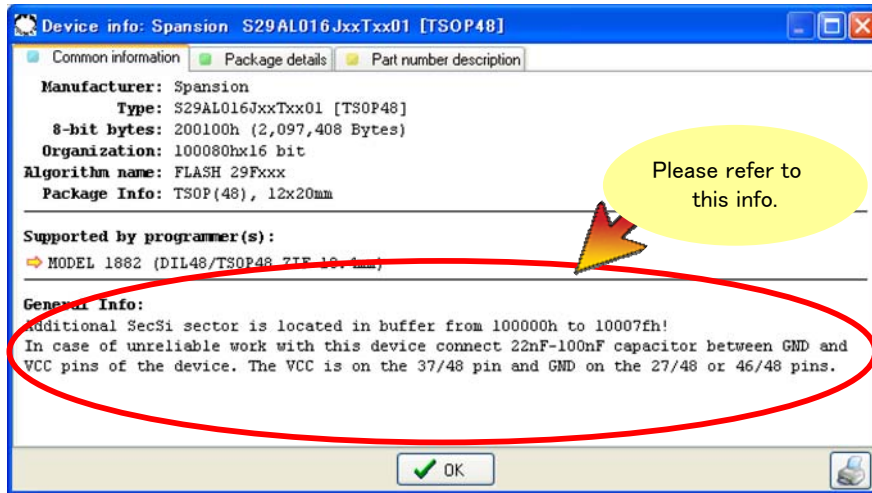

Example: Way to attach capacitor to socket adapter. S29AL016JxxTxx01 [TSOP48]

Socket adapter : DIL48/TSOP48 ZIF 18.4mm

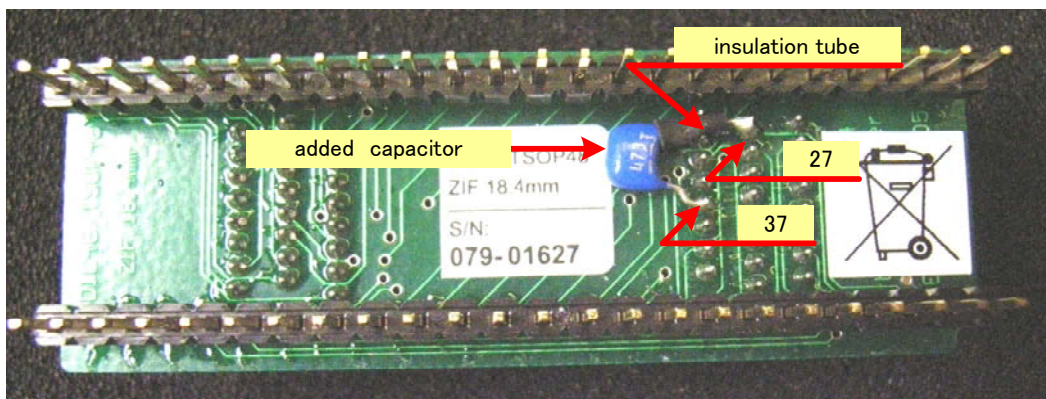

PIN connections of “DIL48/TSOP48 ZIF 18.4mm”

